

 $> 500 M\Omega$ 

Tel.: +49 (0)8121 - 2574100

Fax: +49 (0)8121- 2574101

Email: info@cy-sensors.com http://www.cy-sensors.com

# **Open Loop Hall AC/DC Current Sensor CYHCS-F**

This Hall Effect current sensor is based on open loop principle and designed with a high galvanic isolation between primary conductor and secondary circuit. It can be used for measurement of DC and AC current, pulse currents etc. The output of the transducer reflects the real wave of the current carrying conductor.

Product Characteristics	Applications		
<ul> <li>Excellent accuracy</li> <li>Very good linearity</li> <li>Small size</li> <li>Light in weight</li> <li>Less power consumption</li> <li>Window structure</li> <li>Electrically isolating the output of the transducer from the current carrying conductor</li> <li>No insertion loss</li> <li>Current overload capability</li> </ul>	<ul> <li>Photovoltaic equipment</li> <li>Frequency conversion timing equipment</li> <li>Various power supply</li> <li>Uninterruptible power supplies (UPS)</li> <li>Electric welding machines</li> <li>Transformer substation</li> <li>Numerical controlled machine tools</li> <li>Electrolyzing and electroplating equipment</li> <li>Electric powered locomotive</li> <li>Microcomputer monitoring</li> <li>Electric power network monitoring</li> </ul>		

#### **Electrical Data**

Primary Nominal Current I <sub>r</sub> (A)	Measuring Range (A)	Output voltage (Analog)(V)	Window size (mm)	Part number
200	±400			CYHCS-F200A
400	±800			CYHCS-F400A
500	±1000			CYHCS-F500A
600	±1200	±4 +1.0%	41x14	CYHCS-F600A
800	±1600			CYHCS-F800A
1000	±2000			CYHCS-F1000A
2000	±3000			CYHCS-F2000A

Supply Voltage  $V_{cc}$ = ±12~±15V ± 5% Current Consumption  $I_c$  < 25mA Galvanic isolation, 50/60Hz, 1min: 3kV rms Load resistance: 10k $\Omega$ 

Isolation resistance @ 500 VDC


### **Accuracy and Dynamic performance data**

Accuracy at  $I_r$ ,  $T_A=25^{\circ}$ C (without offset), X <±1.0% Linearity from 0 to  $I_r$ ,  $T_A$ =25°C,  $E_L < \pm 0.5\%$  FS Electric Offset Voltage,  $T_A$ =25°C,  $V_{oe} < \pm 25 \text{mV}$ Magnetic Offset Voltage  $(I_r \rightarrow 0)$  $V_{om} < \pm 25 \text{mV}$ Thermal Drift of Offset Voltage,  $V_{ot}$  <±1.0mV/°C Thermal Drift (-10°C to 50°C),  $T.C. < \pm 0.1\% / ^{\circ}C$ Frequency bandwidth (- 3 dB): DC-20kHz Response Time at 90% of  $I_P$  (f=1k Hz)  $t_r < 7 \mu s$ 

#### **General Data**

Ambient Operating Temperature, Ambient Storage Temperature, Unit weight:  $T_A = -25$ °C ~ +85°C  $T_S = -40$ °C ~ +100°C 217g/unit

#### **Dimensions**

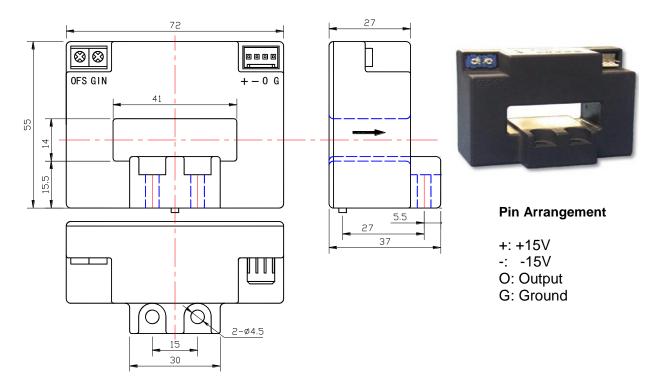

## Notes:

- 1. Connect the terminals of power source, output respectively and correctly, never make wrong connection.
- 2. Two potentiometers can be adjusted, only if necessary, by turning slowly to the required accuracy with a small screwdriver.
- 3. The best accuracy can be achieved when the window is fully filled with bus-bar (current carrying conductor).
- 4. The in-phase output can be obtained when the direction of primary current is the same as the direction of arrow marked on the transducer

http://www.cy-sensors.com