



## Hall Current Sensor CYHCS-K5

This Hall Effect current sensor is based on open loop compensating principle and designed with a split core and a high galvanic isolation between primary and secondary circuits. It can be used for measurement of DC and AC current, pulse currents etc. The output of the transducer reflects the real wave of the current carrying conductor.

| Product Characteristics  | Applications   |
|--|--|
| <ul style="list-style-type: none"><li>• Excellent accuracy</li><li>• Very good linearity</li><li>• Less power consumption</li><li>• Window structure</li><li>• Electrically isolating the output of the transducer from the current carrying conductor</li><li>• No insertion loss</li><li>• Current overload capability</li></ul> | <ul style="list-style-type: none"><li>• <b>Photovoltaic equipment</b></li><li>• Frequency conversion timing equipments</li><li>• Uninterruptible power supplies (UPS)</li><li>• Electric welding machines</li><li>• Transformer substation</li><li>• Numerical controlled machine tools</li><li>• Electric powered locomotive</li><li>• Electric power network monitoring</li><li>• Inverters etc.</li></ul> |

### Electrical Data

| Primary Nominal RMS Current $I_r$ (A) | Measuring Range (A) | Output voltage (V) | Aperture Diameter (mm) | Part number     |
|---------------------------------------|---------------------|--------------------|------------------------|-----------------|
| 2000                                  | 4000                | 4 ±1.0%            | 140 x 50               | CYHCS-K5-2000A  |
| 3000                                  | 5000                |                    |                        | CYHCS-K5-3000A  |
| 5000                                  | 7500                |                    |                        | CYHCS-K5-5000A  |
| 8000                                  | 10000               |                    |                        | CYHCS-K5-8000A  |
| 10000                                 | 12000               |                    |                        | CYHCS-K5-10000A |

Supply Voltage  
Current Consumption at ±15VDC  
Galvanic isolation, 50/60Hz, 1min:  
Load resistance:  
Isolation resistance @ 500 VDC

$V_{cc} = \pm 12 \sim 15 \text{VDC}$   
 $I_c < 25 \text{mA}$   
6kV  
10kΩ  
> 500 MΩ

### Accuracy and Dynamic performance data

Accuracy at  $I_r$ ,  $T_A = 25^\circ\text{C}$  (without offset),  
Linearity from 0 to  $I_r$ ,  $T_A = 25^\circ\text{C}$ ,  
Electric Offset Voltage,  $T_A = 25^\circ\text{C}$ ,  
Magnetic Offset Voltage ( $I_r \rightarrow 0$ )  
Thermal Drift of Offset Voltage,  
Response Time at 90% of  $I_P$  ( $f = 1 \text{k Hz}$ )  
Frequency bandwidth (-3 dB):

$X < 1.0\%$   
 $E_L < 1.0\% \text{ FS}$   
 $V_{oe} < 25 \text{mV}$   
 $V_{om} < \pm 30 \text{mV}$   
 $V_{ot} < \pm 1 \text{mV}/^\circ\text{C}$   
 $t_r < 7 \mu\text{s}$   
DC-20kHz



### General Data

Ambient Operating Temperature,  
Ambient Storage Temperature,

$T_A = -25^\circ\text{C} \sim +85^\circ\text{C}$   
 $T_S = -40^\circ\text{C} \sim +100^\circ\text{C}$



## Dimensions

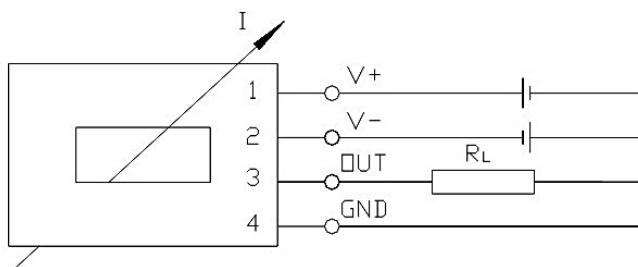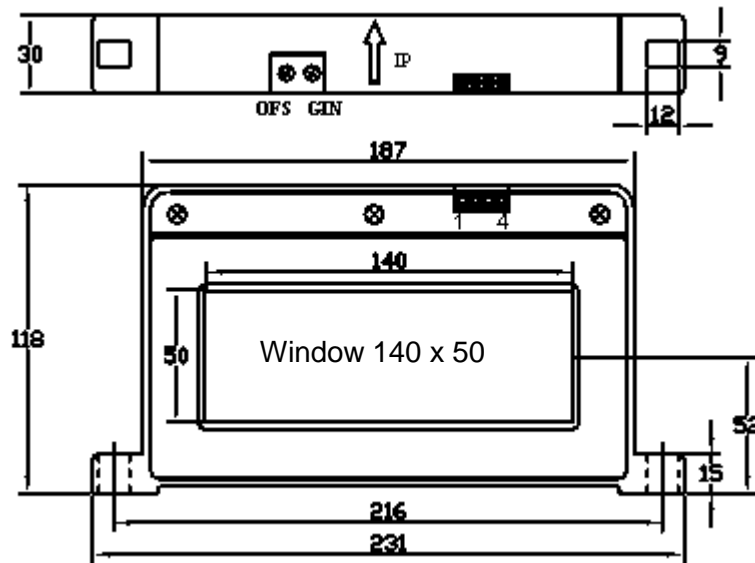

## Terminal Arrangement:

- 1:  $V+$  (+12~15VDC)
- 2:  $V-$  (-12~15VDC)
- 3: OUTPUT
- 4: GND

## Notes:

1. Connect the terminals of power source, outputs respectively and correctly, never make wrong connection.
2. Two potentiometers can be adjusted, only if necessary, by turning slowly to the required accuracy with a small screwdriver.
3. The best accuracy can be achieved when the window is fully filled with bus-bar (current carrying conductor).
4. The in-phase output can be obtained when the direction of current of current carrying conductor is the same as the direction of arrow marked on the transducer